




時規皮帶惰輪
TIMING IDLERS PULLEYS < S8M >



Pulley Shapes :

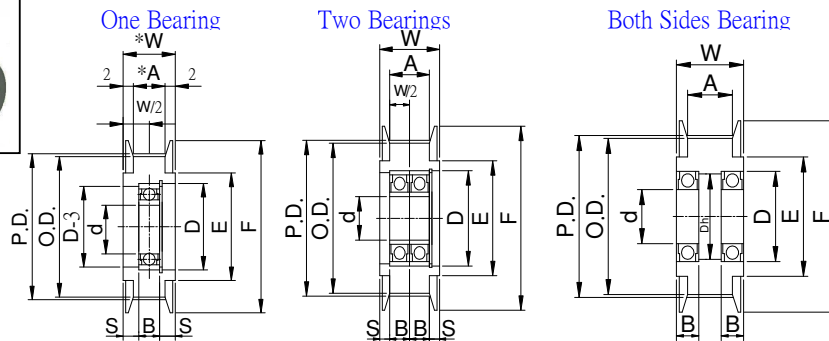

| Type | Material | Treatment | Flange | Flange Treatment |
|-------|----------|--------------------|--------|--------------------|
| IDAAA | A7075 | Anodize | A6061 | Anodize |
| IDAEA | | Electroless nickel | | Electroless nickel |
| IDS | 1045 | — | 1045 | — |
| IDSS | SUS308 | — | A6061 | Anodize |

▲S8M (Central Bearing)

| Type | Catalog No. | | P.D | O.D | F | E | A | W | S | Bearing Size | | | Retaining Ring | | |
|-------------------------------|--------------|------------------|-------|-------|----|----|----|------|----------|--------------|----|----|----------------|--------|--------|
| | No. of Teeth | Teeth Width Code | | | | | | | | No. | d | D | B | IDSS | IDSD |
| IDAAA IDAEA IDS IDSS | 20 | S8M017 | 50.93 | 49.56 | 58 | 40 | 17 | 22 | 6 | 6201ZZx1 | 12 | 32 | 10 | RTWS32 | RTWN32 |
| | | S8M028 | | | | | 28 | 33 | 5.5 | 6202ZZx2 | 15 | 35 | 11 | RTWS35 | RTWN35 |
| | 22 | S8M017 | 56.02 | 54.65 | 61 | 45 | 17 | 22 | 6 | 6201ZZx1 | 12 | 32 | 10 | RTWS32 | RTWN32 |
| | | S8M028 | | | | | 17 | 22 | 6 | 6201ZZx1 | 12 | 32 | 10 | RTWS32 | RTWN32 |
| | 24 | S8M028 | 61.12 | 59.74 | 67 | 50 | 28 | 33 | 6.5 | 6201ZZx2 | 12 | 32 | 10 | RTWS32 | RTWN32 |
| | | S8M033 | | | | | 33 | 38 | 8 | 6202ZZx2 | 15 | 35 | 11 | RTWS35 | RTWN35 |
| | | S8M044 | | | | | 44 | 49 | 13.5 | | | | | | |
| | | S8M017 | | | | | 17 | 22 | 5.5 | 6202ZZx1 | 15 | 35 | 11 | RTWS35 | RTWN35 |
| | 25 | S8M017 | 63.66 | 62.29 | 70 | 56 | 17 | 22 | 5.5 | 6202ZZx1 | 15 | 35 | 11 | RTWS35 | RTWN35 |
| | 26 | S8M017 | 66.21 | 64.84 | 74 | 58 | 17 | 22 | 5.5 | 6202ZZx1 | 15 | 35 | 11 | RTWS35 | RTWN35 |
| | 28 | S8M017 | 71.30 | 69.93 | 80 | 60 | 17 | 22 | 5.5 | 6202ZZx1 | 15 | 35 | 11 | RTWS35 | RTWN35 |
| | | | | | | | 17 | 22 | 5.5 | 6202ZZx1 | 15 | 35 | 11 | RTWS35 | RTWN35 |
| 28 | | | | | | | 33 | 5.5 | 6202ZZx2 | 15 | 35 | 11 | RTWS35 | RTWN35 | |
| 33 | | | | | | | 38 | 5 | 6204ZZx2 | 20 | 47 | 14 | RTWS47 | RTWN47 | |
| 44 | 49 | 10.5 | | | | | | | | | | | | | |
| 30 | S8M017 | 76.39 | 75.02 | 87 | 67 | 17 | 22 | 5.5 | 6202ZZx1 | 15 | 35 | 11 | RTWS35 | RTWN35 | |
| | | | | | | 28 | 33 | 5.5 | 6202ZZx2 | 15 | 35 | 11 | RTWS35 | RTWN35 | |
| | | | | | | 33 | 38 | 5 | 6204ZZx2 | 20 | 47 | 14 | RTWS47 | RTWN47 | |
| | | | | | | 44 | 49 | 10.5 | | | | | | | |
| 32 | S8M017 | 81.49 | 80.12 | 87 | 67 | 17 | 22 | 4 | 6204ZZx1 | 20 | 47 | 14 | RTWS47 | RTWN47 | |
| 34 | S8M017 | 86.58 | 85.21 | 95 | 75 | 17 | 22 | 4 | 6204ZZx1 | 20 | 47 | 14 | RTWS47 | RTWN47 | |

▲S8M (Both Sides Bearing)

| Type | Catalog No. | | Bore d | P.D | O.D | F | E | A | W | Dh | Bearing Size | | |
|-------------------------------|--------------|------------------|--------|-------|-------|----|----|----|----|-----------|--------------|----|----|
| | No. of Teeth | Teeth Width Code | | | | | | | | | No. | D | B |
| IDAAA IDAEA IDS IDSS | 22 | S8M028 | 12 | 56.02 | 54.65 | 61 | 45 | 28 | 33 | 27 | 6201ZZx 2 | 32 | 10 |
| | | S8M033 | | | | | | 33 | 38 | | | | |
| | | S8M044 | | | | | | 44 | 49 | | | | |
| | 24 | S8M028 | 12 | 61.12 | 59.74 | 67 | 50 | 28 | 33 | 27 | 6201ZZx 2 | 32 | 10 |
| | | S8M033 | | | | | | 33 | 38 | | | | |
| | | S8M044 | | | | | | 44 | 49 | | | | |
| | 25 | S8M028 | 12 | 63.66 | 62.29 | 70 | 56 | 28 | 33 | 27 | 6201ZZx 2 | 32 | 10 |
| | | S8M033 | | | | | | 33 | 38 | | | | |
| | | S8M044 | | | | | | 44 | 49 | | | | |
| | 26 | S8M017 | 12 | 66.21 | 64.84 | 74 | 58 | 17 | 22 | 25 | 6001ZZx 2 | 28 | 8 |
| | | S8M028 | | | | | | 28 | 33 | | | | |
| | | S8M033 | | | | | | 33 | 38 | | | | |
| | 28 | S8M044 | 15 | 71.30 | 69.93 | 80 | 60 | 44 | 49 | 27 | 6201ZZx 2 | 32 | 10 |
| | | S8M028 | | | | | | 28 | 33 | | | | |
| | | S8M033 | | | | | | 33 | 38 | | | | |
| | 30 | S8M017 | 15 | 76.39 | 75.02 | 87 | 67 | 17 | 22 | 29 | 6002ZZx 2 | 32 | 9 |
| | | S8M028 | | | | | | 28 | 33 | | | | |
| | | S8M033 | | | | | | 33 | 38 | | | | |
| S8M044 | | 44 | | | | | | 49 | | | | | |
| 30 | S8M028 | 20 | 76.39 | 75.02 | 87 | 67 | 28 | 33 | 37 | 6004ZZx 2 | 42 | 12 | |
| | S8M033 | | | | | | 33 | 38 | | | | | |
| | S8M044 | | | | | | 44 | 49 | | | | | |
| 32 | S8M028 | 20 | 81.49 | 80.12 | 87 | 67 | 28 | 33 | 41 | 6204ZZx 2 | 47 | 14 | |
| | S8M033 | | | | | | 33 | 38 | | | | | |
| | S8M044 | | | | | | 44 | 49 | | | | | |
| 34 | S8M028 | 20 | 86.58 | 85.21 | 95 | 75 | 28 | 33 | 41 | 6204ZZx 2 | 47 | 14 | |
| | S8M033 | | | | | | 33 | 38 | | | | | |
| | S8M044 | | | | | | 44 | 49 | | | | | |

*Ex : IDAA (Central Bearing) IDWAA (Both Sides B)

| | | | | | |
|-------|-------|---|-------------|---|------|
| Order | TYPE | — | Catalog No. | — | Bore |
| 訂貨代號 | IDWAA | — | 30S8M017 | — | 15 |

PS1 : if you need another exceptional to process the specifications form, please contact us.